

UJF-3042MkII series/ UJF-6042MkII

UJF-3042MkII e series/ UJF-6042MkII e

UJF200-3042 / UJF200-6042

Clear Ink Print Guide

This manual describes the effects that can be expressed when clear ink is used in UJF-3042MkII /UJF-3042MkII EX /UJF-3042MkII e /UJF-3042MkII EX e/UJF-6042MkII /UJF-6042MkII e/UJF200-3042 / UJF200-6042, and how to set and print them.

Please read this manual carefully and use it correctly.

Note

- It is strictly prohibited to write or copy a part or whole of this document without our approval.
- This document has been carefully prepared for your easy understanding, however, please do not hesitate to contact a distributor in your district or our office if you have any inquiry.
- Description contained in this document are subject to change without notice for improvement.
- Copying the Mimaki Engineering Co. Ltd. software described in this guide to other disks (except for backup purposes) or loading it to memory except for the purpose of running it, is strictly prohibited.
- Due to improvement or change of software, the description of this document could be partially different in specification, for which your understanding is requested.
- With the exception of what is provided for in the warranty provisions of MIMAKI ENGINEERING CO., LTD., we do not assume any liability against the damages (including but not limited to the loss of profit, indirect damage, special damage or other monetary damages) arisen out of the use or failure to use of this product. The same shall also apply to the case even if MIMAKI ENGINEERING CO., LTD. had been notified of the possibility of arising damages in advance. As an example, we shall not be liable for any loss of the media made using this product or indirect damages caused by the product made using this media.
- You can also download the latest operation manual from our website.

Notations used in this document

- Items and buttons displayed in menus and on screens are marked with square brackets ([]) as in [File].
- RasterLink6, RasterLink6Plus, RasterLink7 and RasterLink8 are referred to as RasterLink in together.

Screen image used in this document

- The explanation is based on the screen image of RasterLink6Plus as an example.

Symbols



- This symbol indicates important information for using this product.



- This symbol indicates useful information.

RasterLink is the trademarks or registered trademarks of MIMAKI ENGINEERING CO., LTD. in Japan and in other countries.

Adobe, the Adobe logo, Acrobat, Illustrator, Photoshop, and PostScript are the trademarks or registered trademarks of Adobe Inc. in the United States and other countries.

CorelDRAW is a trademark or registered trademark of Corel Corporation in Canada, the United States and other countries, and its affiliates.

Microsoft and Windows are trademarks or registered trademarks of Microsoft Corporation of the United States and other countries.

Apple and Macintosh are trademarks or registered trademarks of Apple Inc. of the United States and other countries.

Other company and product names mentioned herein are the trademarks or registered trademarks of the respective companies in Japan and in other countries.

Applicable environment

1. UJF-3042MkII, UJF-6042MkII, UJF-3042MkII e, UJF-6042MkII e

- When the color ink is LH-100, LUS-120, or LUS-150, and the clear ink is LH-100

Printer	UJF-3042MkII F.W. Ver. 1.4 or later UJF-3042MkII EX F.W. Ver. 1.4 or later UJF-6042MkII F.W. Ver. 1.4 or later UJF-3042MkII e UJF-3042MkII EX e UJF-6042MkII e	
Ink	Color/Clear	It can be used in the following combinations. • LH-100 color ink + LH-100 clear ink • LUS-120 color ink + LUS-120 clear ink • LUS-150 color ink + LH-100 clear ink
Mimaki Driver	RasterLink6, RasterLink6Plus RasterLink7 RasterLink8	The version that is compatible with the printer you use. Ver. 5.5.0 or later Ver. 5.13.0 or later
RIP	RasterLink6 RasterLink6Plus RasterLink7 RasterLink8	Ver. 5.9 or later Ver. 1.0 or later Ver. 2.0.0 or later Ver. 1.0.0 or later

- When the color ink is ELH-100, LUS-150, and the clear ink is ELH-100

Printer	UJF-3042MkII F.W. Ver. 6.2 or later UJF-3042MkII EX F.W. Ver. 6.2 or later UJF-6042MkII F.W. Ver. 6.2 or later UJF-3042MkII e F.W. Ver. 4.2 or later UJF-3042MkII EX e F.W. Ver. 4.2 or later UJF-6042MkII e F.W. Ver. 4.2 or later	
Ink	Color/Clear	It can be used in the following combinations. • ELH-100 color ink + ELH-100 clear ink • LUS-150 color ink + ELH-100 clear ink
Mimaki Driver	RasterLink6Plus RasterLink7 RasterLink8	The version that is compatible with the printer you use. Ver. 5.9.14 or later Ver. 5.13.0 or later
RIP	RasterLink6Plus RasterLink7 RasterLink8	Ver.2.20 or later Ver.3.3.2.1 or later Ver.1.0.0 or later

- When the color ink is ELS-120

Printer	UJF-3042MkII F.W. Ver. 6.3 or later UJF-3042MkII EX F.W. Ver. 6.3 or later UJF-6042MkII F.W. Ver. 6.3 or later UJF-3042MkII e F.W. Ver. 4.3 or later UJF-3042MkII EX e F.W. Ver. 4.3 or later UJF-6042MkII e F.W. Ver. 4.3 or later	
Ink	Color/Clear	It can be used in the following combinations. • ELS-120 color ink + ELS-120 clear ink
Mimaki Driver	RasterLink6Plus RasterLink7 RasterLink8	The version that is compatible with the printer you use. Ver. 5.10.1 or later Ver. 5.13.0 or later
RIP	RasterLink6Plus RasterLink7 RasterLink8	Ver.2.22 or later Ver.3.3.4 or later Ver.1.0.0 or later

2. UJF200-3042,UJF200-6042

Printer	UJF200-3042 UJF200-6042	F.W. Ver. 1.0 ~ F.W. Ver. 1.0 ~
Ink	Color/Clear	It can be used in the following combinations. • ELH-100 color ink + ELH-100 clear ink • ELS-120 color ink + ELS-120 clear ink • ELH-100 color ink + EFS-150 fluorescent ink + ELH-100 clear ink • ELH-120 color ink + EFS-150 fluorescent ink + ELH-120 clear ink
Mimaki Driver	RasterLink8	Ver. 5.13.0 or later
RIP	RasterLink8	Ver. 1.0.0 or later

Table of Contents

Note	1
Applicable environment	2
Setting the printer	5
Effects and printing with clear ink	7
Clear ink's effects	7
Ways clear ink can be printed	8
Printing methods	9
Data creation and printing procedures	9
1. Decide the way the clear ink is to be printed	10
A. Printing the clear ink over the whole of the color image	11
B. Printing the clear ink onto the valid pixels of the color image	12
C. Printing the clear ink on top of a color image except on the background (RasterLink7/RasterLink8 only). 13	
D. Printing a special clear ink image	14
2. Select the clear ink's effect: set the UV mode	17
a. Setting Glossy Print	18
b. Setting Matte Print	18
c. Setting Emboss Print	19
3. Set the recommended values for the printing conditions	21
4. Execute printing	22
Setting glossy finish for Emboss Print	23

Setting the printer

Before printing with this Guide, carry out setting of the printer as follows.

1. Turn on the printer's power.

- Wait until <Local> is displayed on the panel.



- If the power is already on, have the panel display <Local>.

2. Select [UV MODE] on the panel, as follows:

- (1) With "Local" displayed, press the **FUNC1** key.
- (2) Use the **▲**, **▼** key to select [SETUP], then press the **ENTER** key.
- (3) Use the **▲**, **▼** key to select [UV MODE], then press the **ENTER** key.
- (4) Use the **▲**, **▼** key to select [ON].
- (5) Press the **ENTER** key.
- (6) Return to [SETUP], by pressing the **END/POWER** key just once.

3. Select [MAPS2] on the panel, as follows:

- (1) Make sure that [SETUP] is selected.
- (2) Use the **▲**, **▼** key to select [MAPS4], then press the **ENTER** key.

4. Select "AUTO" for [MAPS2], as follows:

- (1) Use the **▲**, **▼** key to select "AUTO".
- (2) Press the **ENTER** key.

MAPS 4
: AUTO

5. Return to "Local", by pressing the **END/POWER** key several times.



- If you use the clear ink according to the procedures in this Guide, the settings will be made so that good-quality images are obtained, with the specified quality feel. Sometimes however, the image quality may be poor due to the media material or other factor. In that case, change the setting of 1-4 of the following procedures, please do a test print.

1. Turn on the printer's power.

- Wait until "Local" is displayed on the panel.

Important!

- If the power is already on, have "Local" displayed on the panel.

2. Select [MAPS4] on the panel, as follows:

- (1) With "Local" displayed, press the [FUNCTION] key.
- (2) Use the ,  key to select [SETUP], then press the  key.
- (3) Use the ,  key to select [MAPS4], then press the  key.

3. Select "MANUAL" for [MAPS4], as follows:

- Use the ,  key to select "MANUAL".

MAPS4
: MANUAL

4. After setting to "MANUAL", make the settings for the ink colors, as follows.

- (1) Press the  key.
- (2) Make the setting for [COLOR], as follows.
Use the ,  key to change level. (0 to 100%)
Changing this value will change the color image quality.
Then press .
- (3) Make the setting for [SPOT], as follows.
Use the ,  key to change level.
Changing this value will change the spot color image quality.
Then press .
- (4) Return to "Local", by pressing the  key several times.

Effects and printing with clear ink

Clear ink's effects

The effects below can be obtained by using clear ink.



Glossy feel effect - "Glossy Print"



Matte feel effect - "Matte Print"



3D feel effect - "Emboss Print"

These effects can be obtained via the "UV MODE" settings in RasterLink.



Recommended settings for printing a clear ink

To obtain a better effect of clear ink, please use the recommended setting below for the printing condition and clear ink concentration according to the image quality and printing speed.

- UJF-3042MkII, UJF-6042MkII, UJF-3042MkII e, UJF-6042MkII e
- When the color ink is LH-100 ink / ELH-100 ink / LUS-120 ink / ELS-120 ink

Glossy print

Recommended printing conditions				Recommended density of the clear ink
Resolution	Pass	Print direction	High speed	
600x600 VD	10/16	Uni	OFF	100%

Matte print / Emboss Print

Print mode	Recommended printing conditions				Recommended density of the clear ink
	Resolution	Pass	Print direction	High speed	
Draft	600x600 VD	8/10	Uni	OFF	90%
High Speed	600x900 VD	12/16	Uni	OFF	80%
Standard	600x1200 VD	16/20	Uni	OFF	80%
High Quality	1200x1200 VD	16/20	Uni	OFF	80%

- When the color ink is LUS-150 ink

Glossy print

Recommended printing conditions				Recommended density of the clear ink
Resolution	Pass	Print direction	High speed	
600x600 VD	10/16	Uni	OFF	100%

Matte print / Emboss Print

Print mode	Recommended printing conditions				Recommended density of the clear ink
	Resolution	Pass	Print direction	High speed	
High Speed	600x900 VD	12/16	Uni	OFF	80%
High Quality	1200x1200 VD	16/20	Uni	OFF	80%

- UJF200-3042,UJF200-6042


Print mode	Recommended printing conditions				Recommended density of the clear ink	
	Resolution	Pass	Print direction	High speed	Gloss effect	Matte effect/ Emboss effect
Draft	600x900 VD	6	Uni	OFF	100 %	100 %
High Speed	900x1200 VD	8	Uni	OFF	100 %	100 %
Standard	1200x1200 VD	8	Uni	OFF	100 %	100 %
High Quality	1200x1800 VD	12	Uni	OFF	100 %	100 %

Ways clear ink can be printed


Clear ink can be printed in the ways below with RasterLink.



**Printed over the whole of
a color image**

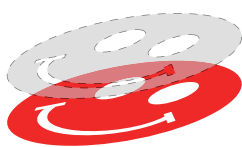

**Printed onto valid pix-
els of a color image**

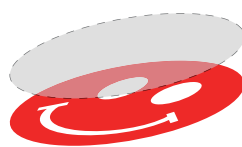

**Printed on a back-
ground other than the
background of the color
image
(RasterLink7/
RasterLink8 only)**



**Printed as a special imag
for clear ink use**


In the case of "Printed over the whole of a color image", "Printed onto valid pixels of a color image", and "Printed on a background other than the background of the color image" (RasterLink7/RasterLink8 only), the "Create Plate" function of RasterLink is used to create a job for clear ink.

In the case of "Printed as a special image for clear ink use" it is necessary to create images exclusively for clear ink using design software such as Illustrator.

Printing methods

Data creation and printing procedures

In order to print, you must first create clear ink data and make the settings for it on RasterLink, using the procedure below.

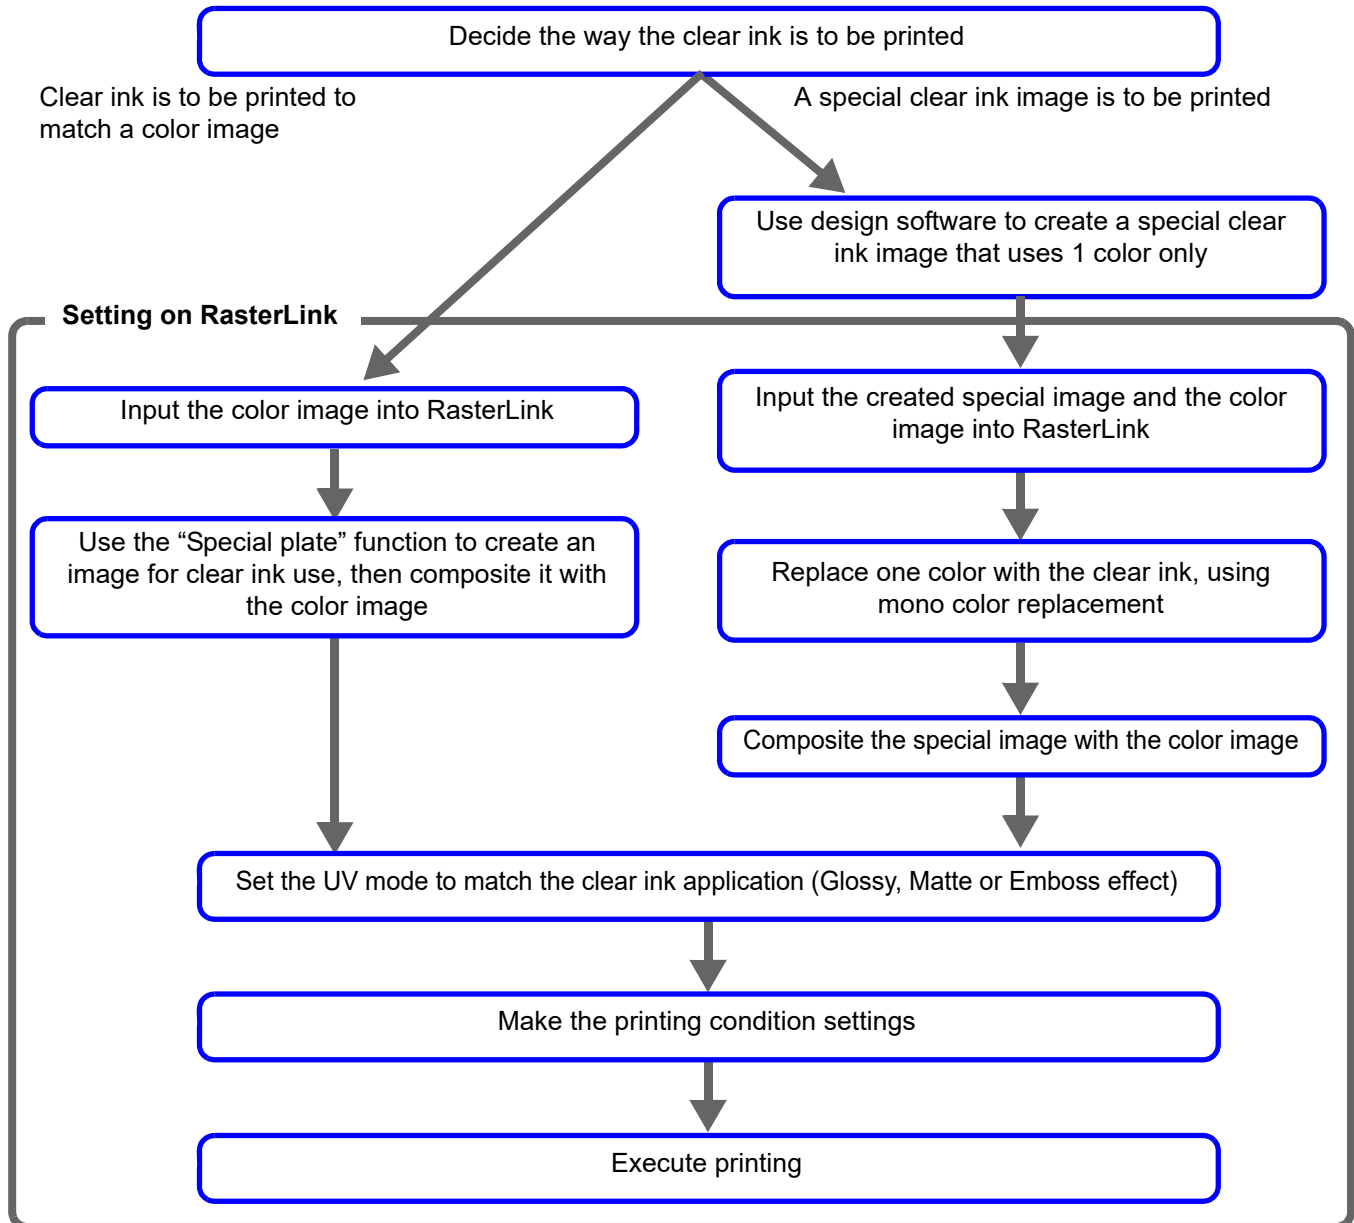


1. Decide the way the clear ink is to be printed

Suppose you have the following color image. You can print the clear ink in any of the three ways shown below.




Print it over the whole of the color image

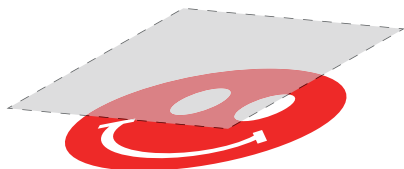


-> Go to [A. Printing the clear ink over the whole of the color image](#)

Print it onto the valid pixels of the color image

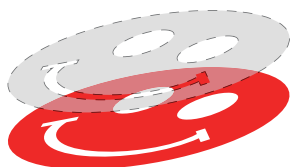

-> Go to [B. Printing the clear ink onto the valid pixels of the color image](#)

Print on a background other than the background of the color image
(RasterLink7/RasterLink8 only)

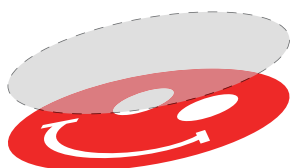

-> Go to [C. Printing the clear ink on top of a color image except on the background \(RasterLink7/RasterLink8 only\).](#)

Print a special image for clear ink use



-> Go to [D. Printing a special clear ink image](#)



- Here, we explain the procedure to create a clear image by setting the concentration of clear ink to 100%. Please refer to the table of [P.7 "Recommended settings for printing a clear ink"](#) and create a clear image with the UV mode you want to print and the density of clear ink suitable for printing conditions.

A. Printing the clear ink over the whole of the color image


To print the clear ink over the whole of the color image, create a special plate on the basis of the image.

1. In the job list, select the job that will be the basis for the plate.


- Click the [Special plate]  icon.

2. Make the settings as follows.

- (1) [Ink]: Select "Clear"
- (2) [Ink volume]: Set "100%"
- (3) [Created area]: Select "Whole image".
- (4) [Composite automatically]: Check the box, and select "Top".
- (5) Click the [Create] button.

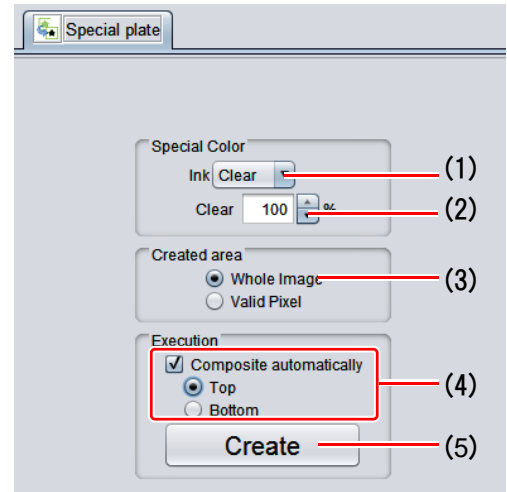

3. The clear ink job will be created, in a composited state.

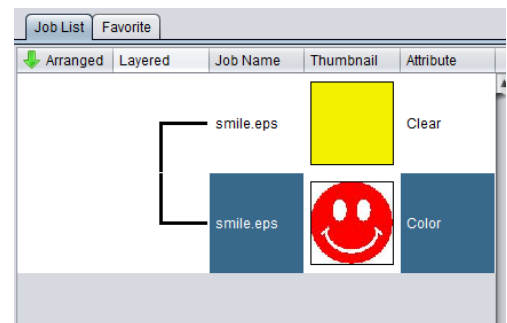

B. Printing the clear ink onto the valid pixels of the color image


To print the clear ink onto the valid pixels of the color image, create a special plate on the basis of the image.

1. In the Job List, select the job that will be the basis for the plate.


- Click the “Special plate”  function icon.

2. Make the settings as follows.

- (1) [Ink]: Select “Clear”
- (2) [Ink volume]: Select “100%”.
- (3) [Created area]: Select “Valid Pixel”.
- (4) [Composite automatically]: Check the box, and select “Top”.
- (5) Click the [Create] button.

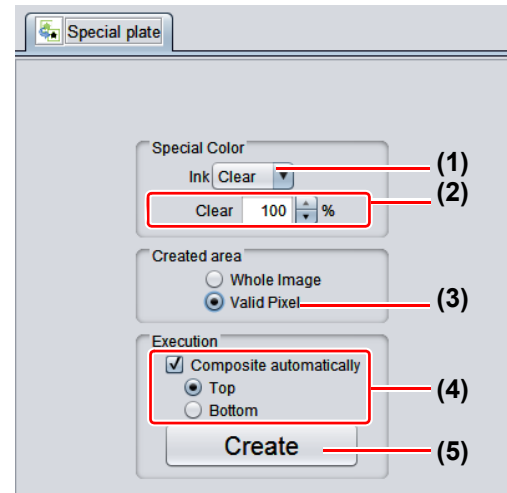

3. The clear ink job will be created, in a composited state.

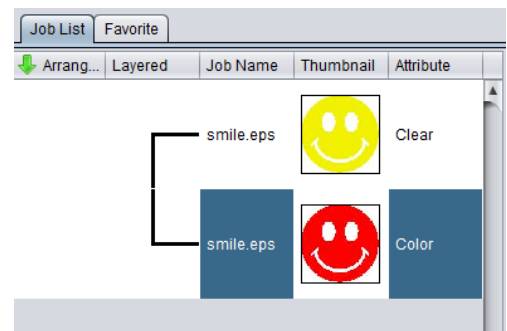

C. Printing the clear ink on top of a color image except on the background (Raster-Link7/RasterLink8 only).

To print the clear ink on top of a color image except on the background, create a special plate on the basis of the image.

1. In the Job List, select the job that will be the basis for the plate.


- Click the “Special plate”  function icon.



Effective when the image data format is EPS, PS, or PDF and a color (including white) is specified in the data section.

2. Make the settings as follows.

- (1) [Ink]: Select “Clear”
- (2) [Ink volume]: Select “100%”.
- (3) [Created area]: Select “Valid to non background”.
- (4) [Composite automatically]: Check the box, and select “Top”.
- (5) Click the [Create] button.

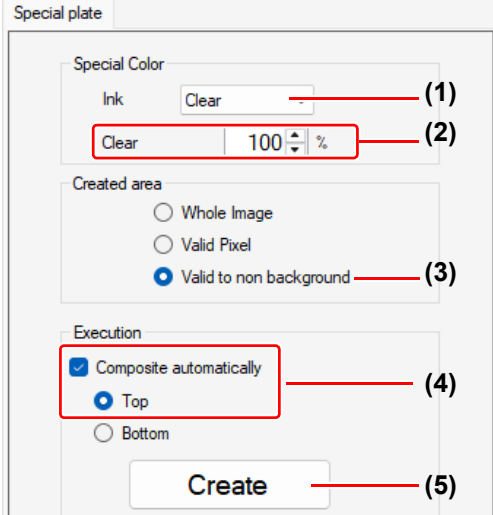

The 'Special plate' dialog box is shown with the following settings:

- Special Color:**
 - Ink: Clear (1)
 - Clear: 100% (2)
- Created area:**
 - ☐ Whole Image
 - ☐ Valid Pixel
 - ☒ Valid to non background (3)
- Execution:**
 - ☒ Composite automatically (4)
 - ☒ Top
 - ☐ Bottom
- Create** button (5)

3. The clear ink job will be created, in a composited state.

Job List				
Arranged	Layered	Thumbnail	Job Name	Attribute
			smile.eps	ClearPlate Type(Matte)
			smile.eps	Color

D. Printing a special clear ink image

To print an image designed for clear ink, create a special image, separate from the color image, and carry out mono color replacement with RasterLink. After that, composite the clear ink image with the color image.

Creating the clear ink image

1. Using design software such as Illustrator or Photoshop, create a clear ink image with the following conditions:


- Color Mode: CMYK
Colors used: One color only - cyan or magenta or yellow or black. Set 100% density for the color. For the other colors, set 0%.
In this procedure, black 100% is used as an example.



Make the clear ink image's size match the color image's.

You can do this by creating a non-fill/non-line path around the periphery of both images, as shown on the right.

You are recommended to save the color image and clear ink image separately from each other after you have done the layout for them with the design software.

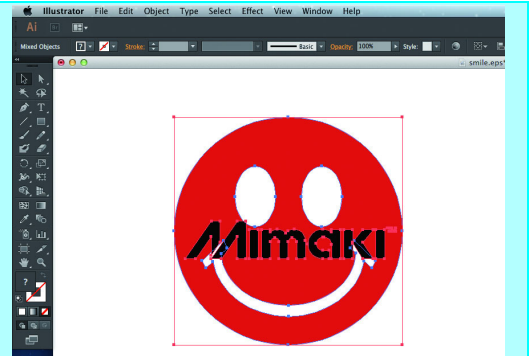


2. Save the created image as an EPS or TIFF image.

3. Import the image saved in procedure 2 into RasterLink.

1. In the job list, select the clear ink job.


- Click the “Properties”  icon.

2. Select “Mono color” in the [Job Attribute] dropdown list.

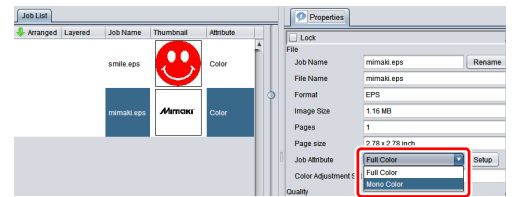


3. Select the [Mono color] tab.

- (1) [Source color]: “Black”
- (2) [Ink]: “Clear”
- (3) Click the [OK] button.

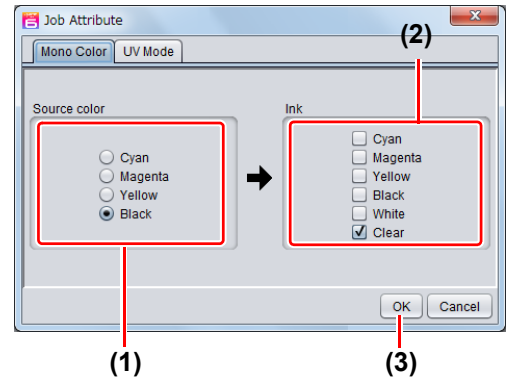

4. The job’s attribute is now “Mono color”. In the job list, the job will have a yellow thumbnail color and “Clear” will be displayed in its “Attribute” field.

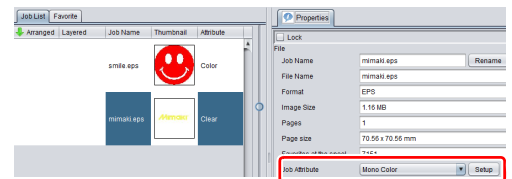


1. In the job list, select the color job and the clear ink job.


- Click the “Composition”  icon.

2. Carry out the following check.

- (1) Is the clear ink job above the color job in the job list.
 - If it is not, use drag and drop to change the positions around.
- (2) After the above check, click the [Composite] button.

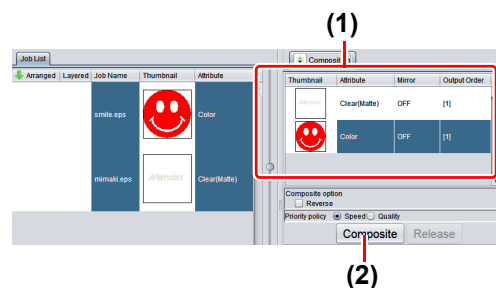

3. The images will be composited.

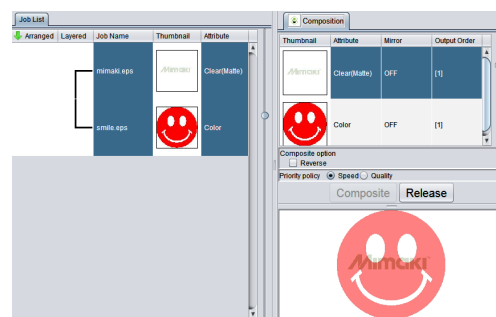

- Printing will be carried out in either of the following ways, depending on the Priority Policy setting on the Composition screen.
 - “Speed”: The color image and clear ink image are printed simultaneously using special color overprinting.
In this case, the UV mode set for the color image is ignored and the conditions set for the clear ink image are used.
 - “Quality”: The color image is printed first and the clear ink image is printed after.
In this case, the UV modes set respectively for the color image and clear ink image are applied respectively to each image.
- In the following cases, however, after printing a color job, regardless of the composition condition setting of the composite screen, print a clear job.
 - Set glossy print
 - Set emboss print
 - UJF-6042 MkII (CMYK + CIPWW)
 - UJF-3042 MkII EX (CMYK + CIPWW)
 - UJF-6042 MkII e (CMYK + CIPWW)
 - UJF-3042 MkII EX e (CMYK + CIPWW)

2. Select the clear ink's effect: set the UV mode

The clear ink's effect is determined by the [UV mode setting] in RasterLink.

Gloss feel effect - "Glossy Print"



-> Go to [a. Setting Glossy Print](#)

Matte feel effect - "Matte Print"



-> Go to [b. Setting Matte Print](#)

3D feel effect - as "Emboss Print"




-> Go to [c. Setting Emboss Print](#)

a. Setting Glossy Print


1. In the job list, select the clear ink job.

- Click the “Properties”  icon.
- Click the [Setup] button in the [Job Attribute] field.

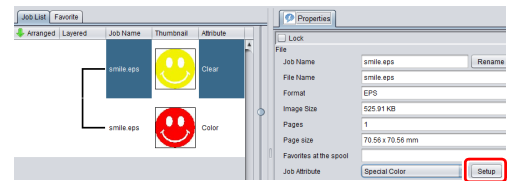


2. Select the [UV Mode] tab.

- Make the settings as follows.
 - (1) Select “Glossy Print” in the mode list on the left side.
 - (2) Set “0” for [Additional UV irradiation].
 - (3) Click the [OK] button.

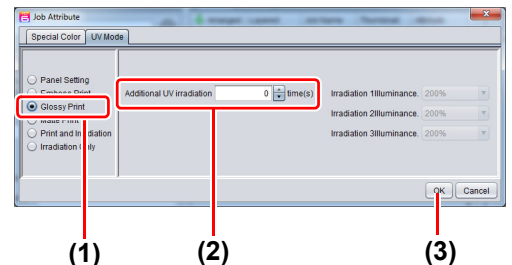


3. Thumbnail of attribute becomes a “Clear (Glossy)”.

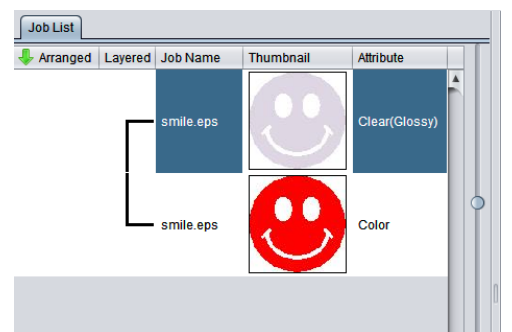

b. Setting Matte Print


1. In the job list, select the clear ink job.

- Click the “Properties”  icon.
- Click the [Setup] button in the [Job attribute] field.

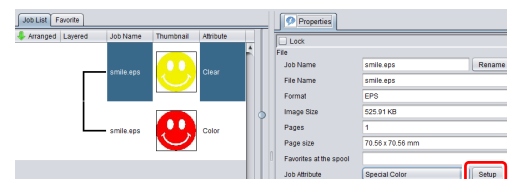

2. Select the [UV Mode] tab.


- Make the settings as follows.
 - (1) Select “Matte Print” in the mode list on the left side.
 - (2) Set “100%” for [Illuminance].
Set “0” for [Additional UV irradiation].
 - (3) Click the [OK] button.

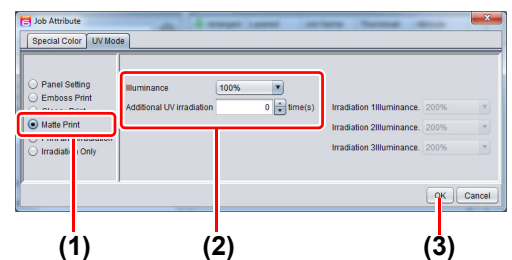

c. Setting Emboss Print


1. In the job list, select the clear ink job.

- Click the “Properties”  icon.
- Click the [Setup] button in the [Job Attribute] field.

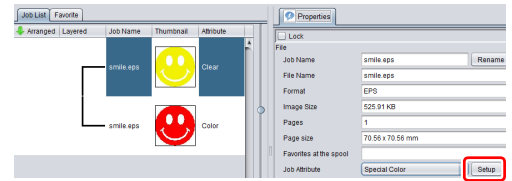


2. Select the [UV Mode] tab.

- Make the settings as follows.
- (1) Select “Emboss Print” in the mode list on the left side.
- (2) [Illuminance]: Set “100%”.
- (3) [Number of printings]: Set this according to the thickness of the embossing. (See “Hint!” below for rough calculation of the number of printings for the thickness).
- (4) Click the [OK] button.

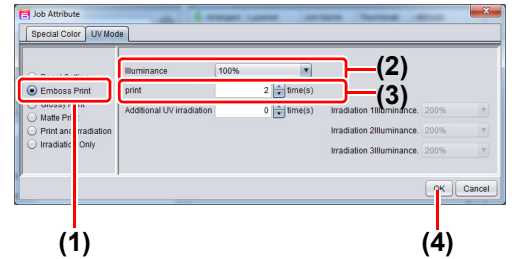

3. Thumbnail of attribute becomes a “Clear(Emboss)”.

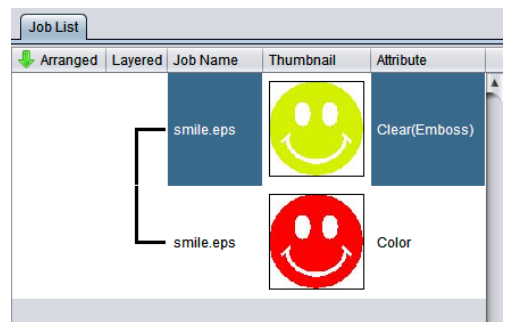



- After you have set Emboss Print, the clear ink job will be printed the specified number of times after the color job is printed, regardless of the Priority policy settings on the Composition screen.
- When print with high head gap, missing nozzle is likely to occur. Recommend the head gap between 1.5mm and 2.0mm and the number of emboss printing up to 20 times.
- At an output resolution with 600x900 dpi, when you print the 100% density clear ink job with the following specified number of times after the color job, the estimated emboss thickness is as follows.

UJF-3042MkII, UJF-6042MkII, UJF-3042MkII e, UJF-6042MkII e

Specified number of times	Embossing thickness [mm]	
	LH-100 / ELH-100 clear ink	LUS-120 / ELS-120 clear ink
2	0.04	0.03
4	0.07	0.06
6	0.10	0.08
8	0.13	0.11
10	0.17	0.13
12	0.20	0.16
14	0.23	0.18
16	0.27	0.21
18	0.30	0.23
20	0.33	0.26

UJF200-3042,UJF200-6042

Specified number of times	Embossing thickness [mm]	
	LH-100 / ELH-100 clear ink	LUS-120 / ELS-120 clear ink
2	0.03	0.02
4	0.05	0.04
6	0.08	0.06
8	0.11	0.08
10	0.13	0.09
12	0.16	0.11
14	0.18	0.13
16	0.21	0.15
18	0.24	0.17
20	0.26	0.19

- When you specify Emboss Print, make sure that there is ample head clearance.
- If you set just Emboss Print, the finish will be matte. See [P. 23](#) for the settings to make in order to obtain a glossy print result.

3. Set the recommended values for the printing conditions

To obtain better effects from the clear ink, use the settings below that are appropriate for the image quality and output speed that you want.

- When the color ink is LH-100 ink / ELH-100 ink / LUS-120 ink / ELS-120 ink

Glossy print

Resolution	Pass	Print direction	High speed
600x600 VD	16	Uni	OFF
600x600 VD	10	Uni	OFF

Matte print / Emboss Print

Print mode	Resolution	Pass	Print direction	High speed
Draft	600x600 VD	8/10	Uni	OFF
High Speed	600x900 VD	12/16	Uni	OFF
Standard	600x1200 VD	16/20	Uni	OFF
High Quality	1200x1200 VD	16/20	Uni	OFF

- When the color ink is LUS-150 ink

Glossy print

Resolution	Pass	Print direction	High speed
600x600 VD	16	Uni	OFF
600x600 VD	10	Uni	OFF

Matte print / Emboss Print

Print mode	Resolution	Pass	Print direction	High speed
High Speed	600x900 VD	12/16	Uni	OFF
High Quality	1200x1200 VD	16/20	Uni	OFF

1. In the job list, select the applicable job.

- Click the “Quality”  icon.

2. Select both the color job and the clear ink job that are displayed in the job list.

- You can select multiple items by holding down the CTRL key while clicking on them.
- By selecting both jobs, you can set the same conditions for both of them.




3. In the profile field (1), select a profile that matches the media to be printed on.

Important!

- When the color ink is LUS-150 ink
When the glossy print is executed, it is necessary to use a profile dedicated to the glossy print.

Ink set	Media	Resolution
LUS-150 CMYK	For clear gloss print	600x600 VD

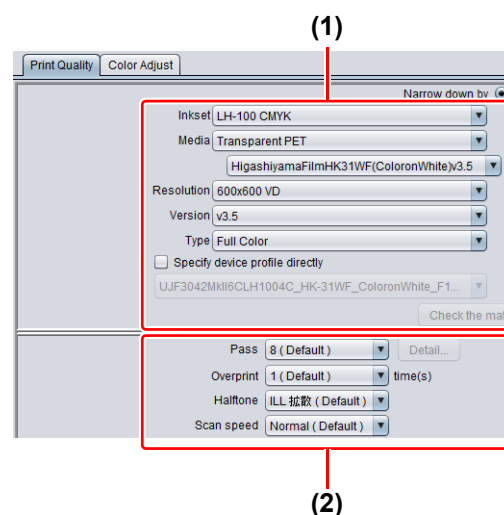

4. Refer to the table above to set the output setting field (2).

4. Execute printing

1. In the job list, select the applicable job.

- Click the “Execution”  icon.

2. Select “RIP and print”.

- Click the [Start] button.


Setting glossy finish for Emboss Print

If you set just Emboss Print, the finish will be matte. To obtain a glossy finish, you must create a Glossy clear ink job, separate from the Emboss Print clear ink job.


1. Referring to “1. Decide the way the clear ink is to be printed” (P. 10~) to , create 1 color job and 2 clear ink jobs.

Important!

- In the case of “A. Printing the clear ink over the whole of the color image” or “B. Printing the clear ink onto the valid pixels of the color image”:
Turn off “Composite automatically” in Special plate printing before creating the clear ink job. Otherwise it will not be possible to create multiple clear ink jobs, since a special plate cannot be made from a composited job. Carry out the above procedure 2 times to create the 2 clear ink jobs.

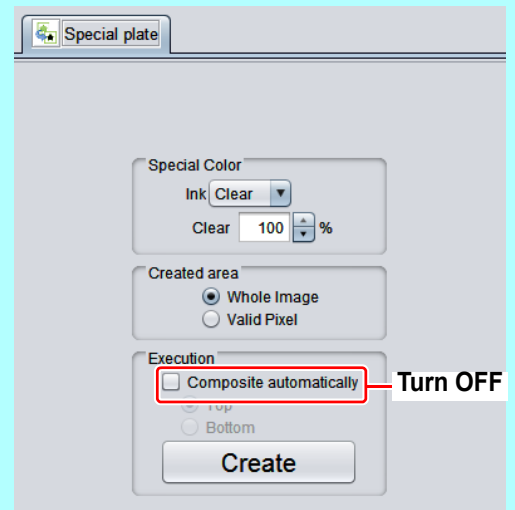


- In the case of “D. Printing a special clear ink image”:
Carry out the “Setting mono color replacement” procedure, then carry out the following procedure to duplicate the job.
 - Select the clear ink job.
 - Click the “Duplicate”  icon.
 - Set “1” for [Number of duplicates], and click the [Duplicate] button.
The clear ink job will be duplicated.

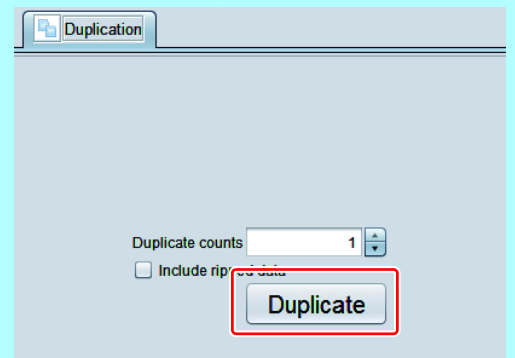


2. Choose one job of clear ink from the job list.

- Refer to “c. Setting Emboss Print” and set the thick print.

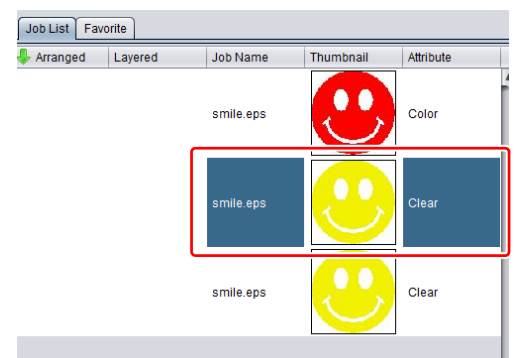

3. Choose the job of clear ink from the job list that is not selected in step 2.

- Refer to “a. Setting Glossy Print” and set the glossy print.

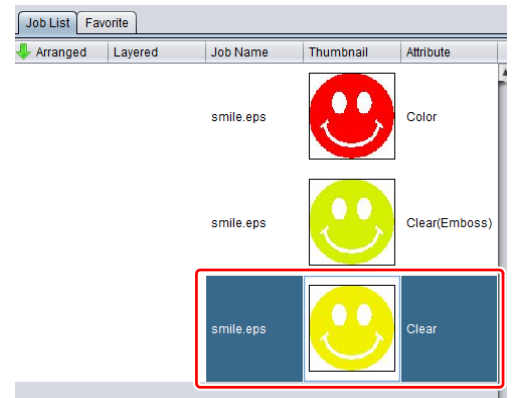


4. Choose the color job and clear ink of step2+3 from the job list,


- Press [Composite]  from function icon.

5. Check the following.

- (1) From the top order of the list
Clear(Glossy) -> Clear(Emboss) -> Color
Check the order
- If the order is not as above, please replace the composition List by Drag & Drop.
- (2) Press [Composite] button.

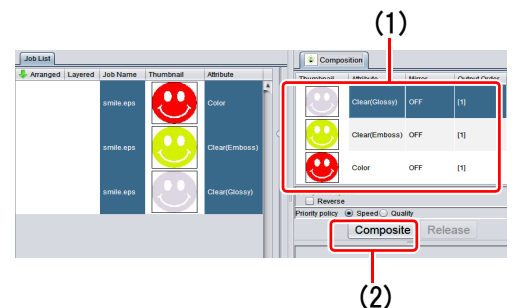

6. Synthesized.

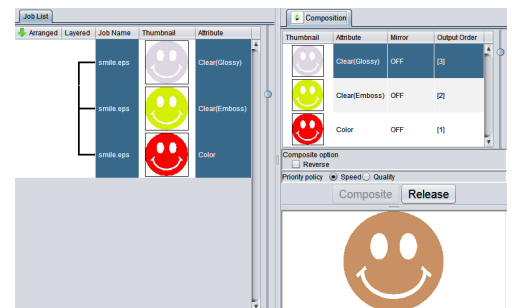

7. Execute printing.

