## UV インクジェットプリンタをお使いのお客様へ



■高反射率のメディアへのプリントは、十分に注意が必要です。


例) 鏡、ステンレス研磨板 金/銀箔 等

- ・事前に十分にテストを行い、ノズル抜け、曲がりが発生するメディアは使用しないでください。
- ・メディア表面の反射により、ヘッド故障した場合には、保証の範囲外となることもありますので、 ご了承ください。


## ■広いギャップで使用する時の注意


メディア (ワーク) とヘッドのギャップを推奨値 1.5 mm でお使い頂けますようお願いいたします。インクジェットプリンタはギャップが 2 mm 以上広がると、インク滴がメディアに到達できずにミスト化する傾向があります。ギャップが広がるとその傾向は強くなります。発生したインクミストは、ヘッドのインク吐出面や冷却用ファンのフィルターに付着したり、印刷物に付着します。同時にギャップが広い場合、UV 硬化ランプからヘッド面に対する反射光も増えます。インク吐出面に付着したインクミストが UV 反射光で硬化したり粘度が増したりすると、吐出インクの着弾すれやノズル詰まりの原因となります。ヘッドの交換が必要な故障となる場合もあります。


1. 印刷面の凸部/凹部は治具等で平面になるようにしてください。 また、フリスビー・皿等の凸立体物への印刷の場合、端部R形状を塞ぐようにしてください。

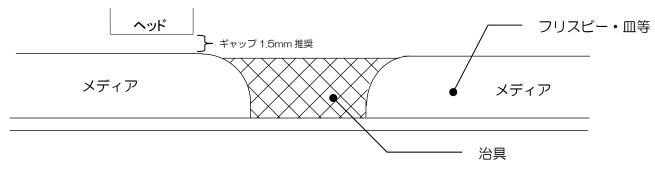

2. 立体物の印刷には反射光を防ぐために吸着盤面の余白を覆ってください。 (ヘッドの移動やYバー移動の妨げにならぬようお願いします)





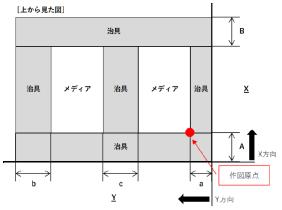

推奨治	具サイズ (Full印刷時 ※1参照)
Y	a: b: d0mm c: 任意(メディア間を隙間なく治具で埋めること)
х	A: B: 120mm

※1 フル幅印刷時のセット可能治具サイズ

		JFX200 Series	JFX500-2131	UJF-7151Plus	UJF-3042 MkII/MkIIe	JFX600-2513
				UJF-7151PlusII	UJF-6042 MkII/MkIIe	JFX550-2513
Υ	а	40mm	7.5mm	49mm	32mm	40mm
	b	40mm	7.5mm	49mm	32mm	40mm
х	Α	120mm	47mm	53mm	22mm	50mm
	В	120mm	47mm	19mm	22mm	120mm
_						

- ■メディアに対する除電対策を実施してください。
  - 例)イオナイザ、除電バー、ウォーターミスト加湿、アルコール系の帯電防止剤 ※イオナイザは、標準添付モデル、またはオプション対応機種で取り付け可能です。 ※界面活性剤を含む帯電防止剤は、使用しないでください。




## For Customers Using UV Inkjet Printers,

- Print on the highly reflective media with enough care.
  - e.g.) Mirror, polished stainless steel plate, gold foil and silver foil etc.
  - Perform test in advance, and do not use the media causing nozzle clogging and deflection.
  - Please note that the head broken by reflection of the media surface may not included in the warranty.
- Precaution when printing in head gap more than 2 mm


Head gap should be 1.5 mm of our recommendation from media surface to head surface. In the inkjet printer, ink drops tend to turn into mist when the gap between head and media is set wider than 2mm, since ink cannot reach the media. The wider the gap gets, the more likely it occurs. The mist of ink adheres to the head surface, the filter of the cooling fan, and the printed product.

Also, the reflection of the UV light becomes higher with wider gap. In case the adhered mist of ink is cured or gets sticky by the UV light reflection, it causes nozzle deflection and nozzle clogging. Sometimes it may lead to a failure which requires head replacing.

Please flatten the uneven surface of the media by jig or something.
And please cover the R-shaped edge when printing on convexed materials such as Frisbee or dish.

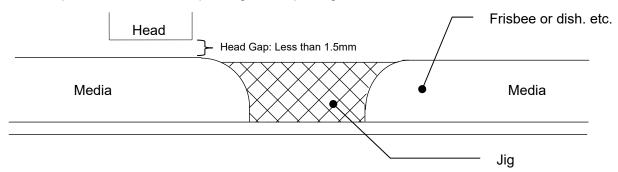

2. Please cover the blank space of the table to prevent the reflection of the UV light when printing on thick materials. (Make sure it does not interfere with the head and Y bar movement.)

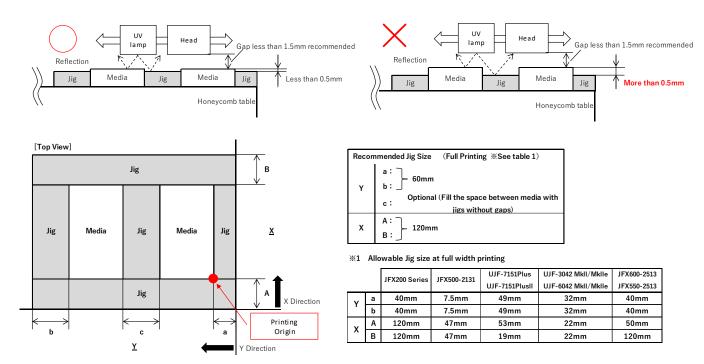

- Please take measures to have the media electrically discharged.
  - e.g.) Ionizer, electricity removal bar, water mist humidification or antistatic agent (alcohol type), Neutralization apparatus: ionizer(head fix type)
    - Xlonizer is fixed as standard accessory or selectable as optional items depending on the model.
    - \*Do not use antistatic agent including surfactant.